

MARION COUNTY SURVEYOR'S OFFICE


SECTION CORNER RECORD

DEBRA S. JENKINS
MARION COUNTY SURVEYOR

SEC. 10 TWN. 15_N RNG. 2_E

BRYAN F. CATLIN, PLS
TECHNICAL SUPERVISOR

Date: 5-20-09
Party Chief: Greene
Crew: Taylor / Finney
Type of Marker: Harrison
Method of Establishment: County: 7-13-1997 EDM ties
IN S.P.C. E Zone, NAD 83
Name: 15021001
N: 501 517.097 1(m)
E: 45 051.820 6(m)

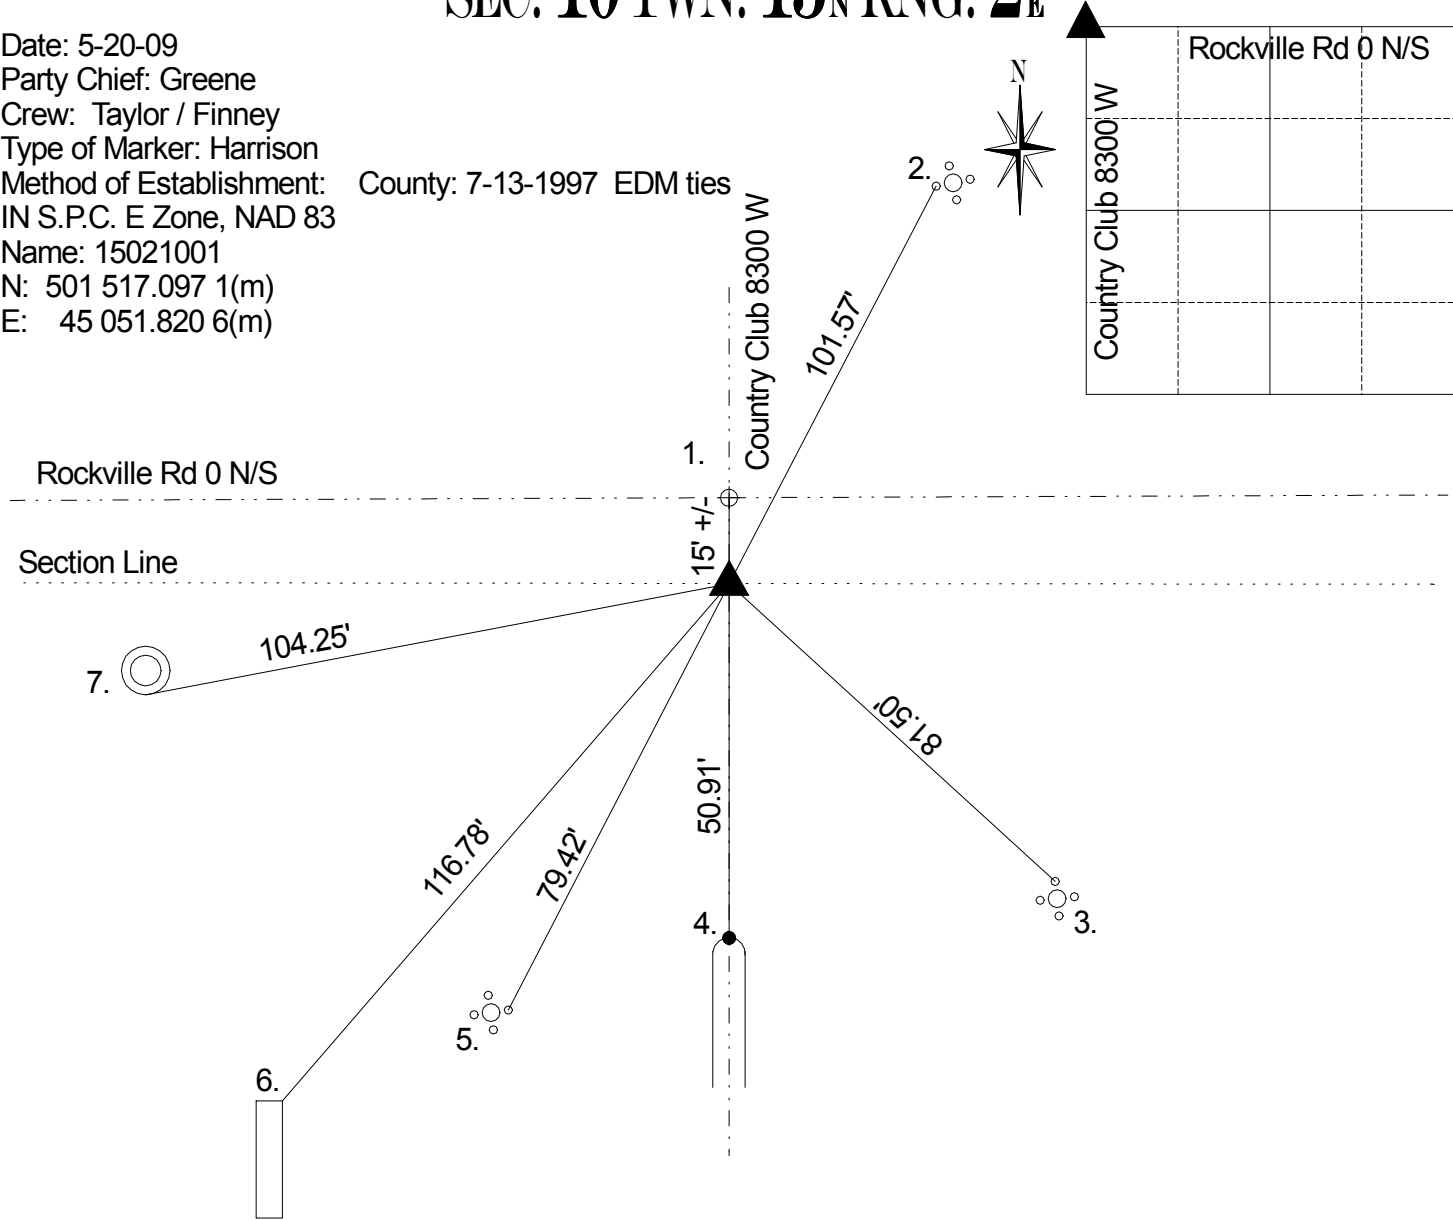

Original post set 1820 by Laughlin with witnesses: 5" buckeye N 51 E 22 links, 8" sugar S 48 E 47 links per Marion County Atlas pg. 2. Coyner 4-19 and 4-20 1900 called rock fd w/ no witnesses per Wayne Township Legal Survey book pg. 88. Monroe 6-27-1952 called nail. Monroe 3-2-58 called same. Miller 2-26-76 called brass plate. Wilcoxon 11-3-76 called steel plate was replaced by brass plug. Ross 8-15-86 called same. Wilcoxon 11-25-95 called same. Excavated by Wilcoxon 6-3-97 and Harrison set per accordance with Rockville Rd construction project. Retied 9-21-03 by Wilcoxon. Retied 5-20-09 by Greene.

REF.	DISTANCE	DESCRIPTION
1.	15' +/-	Due N to C/L of Rockville Rd
2.	101.57'	Cut 'x' W bolt aluminum pole
3.	81.50'	Cut 'x' N bolt of aluminum pole
4.	50.91'	Set mag nail w/ MCSO brass washer in crack of curb of median
5.	79.42'	Cut 'x' E bolt aluminum pole
6.	116.78'	NE corner brick sign
7.	104.25'	Cut 'x' S rim Bell Telephone manhole